

# GIL - AUTO MAINTENANCE & SERVICE TAX INVOICE :

99 Edgecliff Rd  
www.gilauto.com.au  
BONDI JUNCTION NSW 2022

PHONE: (02\_) 93898224  
FAX: (02\_) 93895282

E-MAIL: gilauto@bigpond.com



Safer Brakes Pty Ltd Aug 05  
ACN ABN24003756269

Sample Sample  
Sample  
Sample  
WvwXXXXXXXXXXXXXXXXX  
NSW 0000

Registration No.: **TEST**  
Vehicle: Volkswagen Polo  
Odometer: 68,437  
Year:

Job: 2009070936  
Date: 09-07-2009  
Page: 1

Comment	Qty	Unit Cost	Extension
<b><u>Mechanical Inspection</u></b>			
REPORT	1.00	272.73	272.73
<b><u>GST</u></b>			
GST	1.00	27.27	27.27
ROAD TEST			
Squeak evident at passenger side front area			
Rattle evident at passenger side front area			
Knock evident at passenger side front area			
Pinging evident whilst driving			
Rattle at air conditioner compressor area			
Service light is on			
Steering wheel pulsations evident when braking			
Bearing type noise evident whilst driving			
Front wipers judder when being operated			
Passenger side door squeaks when closing at latch area			
Steering wheel not central when in the straight ahead position			
ENGINE COMPARTMENT			
Engine oil leak at oil filter area			
Engine oil leak at sump area			
Engine oil leak between engine and transaxle			
Engine oil leak at rear of engine area			
Plastic stone tray on driver side has a bolt not attached			

# GIL - AUTO MAINTENANCE & SERVICE TAX INVOICE :

99 Edgecliff Rd  
www.gilauto.com.au  
BONDI JUNCTION NSW 2022

PHONE: (02\_) 93898224  
FAX: (02\_) 93895282

E-MAIL: gilauto@bigpond.com



Safer Brakes Pty Ltd Aug 05  
ACN ABN24003756269

Sample Sample  
Sample  
Sample  
WvwXXXXXXXXXXXXXXXXX  
NSW 0000

Registration No.: **TEST**  
Vehicle: Volksvagen Polo  
Odometer: 68,437  
Year:

Job: 2009070936  
Date: 09-07-2009  
Page: 2

Comment	Qty	Unit Cost	Extension
Battery tested no good			
Number 3 coil on plug is cracked on top			
Oily dirt evident at rocker cover area			
<b>COOLING SYSTEM</b>			
Coolant leak at bottom hose at radiator connector area			
<b>TYRES AND WHEELS</b>			
Driver side front tyre is worn out			
Passenger side front tyre is worn out			
Passenger side front tyre has side wall damage			
Driver side rear tyre case is cracking between treads			
Driver side rear tyre has side wall damage			
Passenger side rear tyre case is cracking between treads			
Passenger side rear tyre has side wall damage			
Driver side front mag wheel is damaged			
Passenger side front mag wheel is bent			
Driver side rear mag wheel is damaged			
Passenger side rear mag wheel is damaged			
<b>BRAKES</b>			
Driver side front brake pads have worn the centre contact surface of the brake disc rotor leaving a lip on the top and the bottom of the brake disc rotor. The front brake disc rotor measurement = 17.95 mm. Brake disc rotor minimum thickness = 19 mm			

# GIL - AUTO MAINTENANCE & SERVICE TAX INVOICE :

99 Edgecliff Rd  
www.gilauto.com.au  
BONDI JUNCTION NSW 2022

PHONE: (02\_) 93898224  
FAX: (02\_) 93895282

E-MAIL: gilauto@bigpond.com



Safer Brakes Pty Ltd Aug 05  
ACN ABN24003756269

Sample Sample  
Sample  
Sample  
WvwXXXXXXXXXXXXXXXXX  
NSW 0000

Registration No.: **TEST**  
Vehicle: Volkswagen Polo  
Odometer: 68,437  
Year:

Job: 2009070936  
Date: 09-07-2009  
Page: 3

Comment	Qty	Unit Cost	Extension
Passenger side front brake pads have worn the centre contact surface of the brake disc rotor leavin a lip on the top and the bottom of the brake disc rotor. The front brake disc rotor measurement = 17.97 mm. Brake disc rotor minimum thickness = 19 mm			
Front discs should be changed as soon as possible			
Driver side rear drum has a lip on the edge			
Passenger side rear drum has a lip on the edge			
Rear brakes need adjustment			
Brake fluid moisture content = 2%, should be no more than 2%			
DRIVETRAIN			
Fluid leak at driver side inner cv shaft area			
Fluid leak at passenger side inner cv shaft area			
Fluid evident on transaxle area			
STEERING			
Power steering fluid level is low			
SUSPENSION			
Driver side front lower control arm rear bush is cracked			
Passenger side front lower control arm rear bush is cracked			
Passenger side rear shock absorber is leaking			
CABIN			
Heater ventilation air conditioner system not working properly (does not always go from hot to cold)			
Gear stick cover is tarnished			

# GIL - AUTO MAINTENANCE & SERVICE TAX INVOICE :

99 Edgecliff Rd  
www.gilauto.com.au  
BONDI JUNCTION NSW 2022

PHONE: (02\_) 93898224  
FAX: (02\_) 93895282

E-MAIL: gilauto@bigpond.com



Safer Brakes Pty Ltd Aug 05  
ACN ABN24003756269

Sample Sample  
Sample  
Sample  
WvwXXXXXXXXXXXXXXXXX  
NSW 0000

Registration No.: **TEST**  
Vehicle: Volkswagen Polo  
Odometer: 68,437  
Year:

Job: 2009070936  
Date: 09-07-2009  
Page: 4

Comment	Qty	Unit Cost	Extension
No indication of cabin filter being changed			
Driver side front window regulator is noisy when operated			
Passenger side front seat belt is starting to fray			
BOOT			
Clip on driver side to hold rope for parcel tray is broken			
MISCELLANEOUS			
Timing belt should be changed every 4 years			

-----  
**TOTAL** **\$300.00**  
-----